

In Uherske Hradiste 1<sup>th</sup> November 2018

Overview: This letter authorizes Sport Flying USA Services, LLC. 500 Airport Road Suite D. Lititz, Pennsylvania 17543 to repair N593BL S/N 093/2014 left and right side skin next to landing gear box with an 0.032 aluminum doubler on the exterior of side skin and 3/4" aluminum angle on the interior of the side skins installed vertically to reinforce areas that had been previously damaged by a hard landing. Cracks in aluminum side skin should be stopped drilled to prevent further cracking. Aluminum doubler and 3/4" aluminum angle will be 1/8" Avex riveted and adhered in to place with Emfimastic PU 50. Repair should then be covered with corrosion resistant primer. Wing root skins riveted back into place. Wing root composite fillets adhered back into place with Emfimastic PU 50. Paint to Spec. This Letter of Authorization (LOA) is approved only for **BRM Aero Bristell SLSA S/N 093/2014**. A log book entry in the aircraft logbook for the work completed is required.

*Reference photos and notes below for the repair underneath wing root skin.*



Milan Bristela  
Managing director



**BRM AERO, s.r.o.**  
Letecká 255  
686 04 KUNOVICE  
IČO: 291 90 924, DIČ: CZ29190924

Adresa: Vaclava Kulfaska 1224, 686 05 Uherske Hradiste  
e-mail: milan.bristela@gmail.com  
Tel.: +420 773 984 338

ICO: 291 90 924  
DIC: CZ29190924  
www.brmaero.com